



Global test

Expert/Global Test
VehicleIdmenu_tgref.s: 81_02

FAMILY CALCULATOR NO.	
4	Smart Service Box BSI2010 (4 Defects)
U1F00 00 Defect Event Not Recorded in the Defect Journal	
Properties	
Local Origin	
Present Statute	
Features -	
B180E 87	Hands-free remote control authentication defect not present in the calculator
Properties	
Local Origin	
Fugitive Status	
Features No response to request	
B1715 64	Lack of consistency between the vehicle's lock status and the Lock the right front door lock
Properties	
Local Origin	
Fugitive Status	
Features Inconsistency	
B1716 64	Lack of consistency between the vehicle's lock status and the Left front door lock lock
Properties	

Local Origin	
Fugitive Status	
Features	Inconsistency

1



Motor Control Calculator

EDC17C60 (1 Defects)


P242F 00 Particulate Filter			
Properties			
Local Origin			
Permanent Status			
Characteristics of the defect Filter detected used			
List of associated variables			
Total mileage	204138	km	
Date	161237	s	
Crankshaft engine speed	0	R/min	
Pedal position accelerator	0	%	
Vehicle speed	0	Km/h	
Motor water temperature	22	°C	
Supply voltage of the Motor Control Calculator	12.30	V	



Anti-lock wheel (ABS) or dynamic stability control (ENG)

Communication error

1



Automatic gearbox or Manual piloted

BVA_AM6_AT6_UDS (1 Defects)


P160E 01 Positive Power After Contact (Contact Cut)			
Properties			
Fugitive Status			
Characteristics of the defect Power defect			

2 of 6

06/10/2025 12:22

List of associated variables

There's no value to show



Engine service box

★ **BSM_2010**

Attention, calculator present in the vehicle but telecoded as absent




Steering wheel controls COM2008P



Steering wheel controls
/ steering wheel with controls
Integrated

VCI



Anti-theft alarm

★ **MOUSSE**

Attention, calculator present in the vehicle but telecoded as absent



SIR burglar alarm siren



1

Windshield wiper model
Left Front

MOTEV_UDS (1 Defects)

B11B1 81 Cleaning setpoint defect from the smart service box

Properties


Fugitive Status

Characterization of the ruling Missing or invalid consignment



Front right wiper wheel


MOTED_UDS



Air conditioning

★ **BCC**


Attention, calculator present in the vehicle but telecoded as absent



On-board
dashboard

★ **Unknown calculator**

Gradient mode: This information is not guaranteed

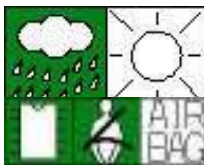

Rain and light collector

PLUIE_LUMINOSITE_UDS

Calculator Inflatable


Cushions & Pretensioners

RBG_UDS




Battery Charge Status Box

BECB_GEN2



FMUX multiplexed front



Parking assistance

AAS_UDS



Telematics box (RTx)
or
Radio navigator

SMEG_PLUS



LCE Electronic Key Reader



Electric Steering Anti-Theft



Unknown calculator

Gradient mode: This information is not
guaranteed



Smart Service Box




BSG_S

Attention, calculator present in the
vehicle but telecoded as absent




Conductive door module

PDPC_UDS




Protection and feed management
box

BPGA2010



Automatic gearbox electric control
calculator

COMELEC2



Electronic hands-free start
access box

BML

1 Power Steering DAE_BVH2 (1 Defects)



C1406 Overheating of the Engine or Power Steering Calculator

Properties

Statute Fugitive Defect

Characteristics of the Uncharacterized Defect

List of associated variables

Mileage 33565		Km Vehicle speed 0	
Km/h Steering wheel torque 0.0		N.m	
STEERING ANGLE 0		°	
Electric steering torque setpoint	-127	N.m	
Electrically assisted			
Supply voltage 12.1		V	
Temperature calculator Power steering	15	°C	
Overheating direction Electrically assisted	NO		
Support	NO Status +		
Contact	Activated		
Engine status Engine cut off			




Tension Maintenance Device

DMTC
Attention, calculator present in the vehicle but telecoded as absent




Diesel additive pump PADDGO_INERGY




Additional heating Communication error




Urea calculator Not present present



Trailer service box Not



External CD Player Not Present




Audio amplifier

Not present




**Multifunction Video Camera
(CVM)**

Do not




**Helps to respect
intervehicle time**

present Do

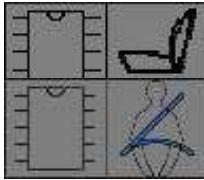

Driver's seat position memory box

not present



**Right reversible seat belt
winder**

Do not



**Left reversible seat belt
winder**

present Do


not present

**Do not
present**




Dynamic headlight height corrector

Not present




**Service module/telematics box
autonomous**

Do not present




Luggage compartment Module

Not present




**Paranamic Visual Aid
Calculator**

Do not present




**Hands-Busy Access Calculator ,
Right or Back Side**

Do not present



Touch screen

Not present



**Driver's Seat Comfort
Calculator**

Do not present